



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX

Inspection report

Summary of key check points:

No.	Key check points	Result	Details refer to
1.	Workmanship (AQL)	☒ Pass ☐ Fail	Section A
2.	Product requirement verification	☒ Pass ☐ Fail ☐ Pending ☐ N/A	Section B-1)
3.	Plug verification check (Sales destination: Switzerland))	☒ Pass, the plug conformed to the sales destination ☐ Fail, the plug did not conform to the sales destination ☐ N/A	Section B-1)
4.	Critical component check	☒ Pass ☐ Fail ☐ Pending ☐ N/A	Section D
5.	Importer information (on rating label)	☒ Pass ☐ Fail ☐ Pending ☐ N/A	Section B-1)
6.	Bar code check	☒ Pass ☐ Fail ☐ Pending ☐ N/A	Section B-1)

Overall Inspection Result:

INSPECTION RESULT :	☒ PASS
---------------------	---

Client:	-	Contact Person:	-	Tel:	-
Partner & Division:	-	Technical Advisor:	-	QA number:	-
Inspection Date:	20XX-XX-XX	☐ 1 st / 2 nd Re-inspection (Previous Report No.)			
Product Description:	LED Robe Kugel gross 50cm, warmweiss LED Robe Kugel klein 30cm, warmweiss LED Tannenbaum gold 120cm IP55 LED Stern gold 60cm IP55 LED Laterne 120cm IP55 LED Rentier 130cm IP55 LED Schneemann gold 120cm IP55 Set of 3 lighted glitter candle IP55 LED Rentier mit Schlitten (Geschenkboxen)				
Supplier Name:	-				
Manufacturer Name:	-				
Manufacturer Location:	-				
Manufacturer Contact:	-				
Service Required:	FRI (Final Random Inspection)				

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX

P/O No.	Item No.	Order Qty.	Shipment Qty.:	Sales destination	Carton Qty.:	Inspected Qty.	Packed CTN (%)	Production (%)	Sample Size
7206256269	6.736.026	138	138	Switzerland	138	138	100	100	6
7206256269	6.736.027	243	243	Switzerland	243	243	100	100	12
7206256269	6.968.249	179	179	Switzerland	179	179	100	100	9
7206256269	6.968.250	446	446	Switzerland	446	446	100	100	22
7206256269	6.968.475	926	926	Switzerland	926	926	100	100	45
7206256269	6.968.476	695	695	Switzerland	695	695	100	100	34
7206256269	6.968.548	904	904	Switzerland	904	904	100	100	44
7206256269	6.976.357	230	230	Switzerland	230	230	100	100	11
7206256269	7.260.143	341	341	Switzerland	341	341	100	100	17

Remarks and Comments

	Please confirm	Status																		
1	Pull check for adaptor housing was conducted by hand as hard as the inspector can due to no factory spec available.	Information																		
2	The factory does not have tumbling test equipment but provided a tumbling test report. <table border="1"> <tr> <td>1.7 (7.13.2)</td><td>Metal parts have adequate mechanical strength</td><td>N/A</td></tr> <tr> <td>1.7 (7.13.3)</td><td>Test with straight unjointed test finger</td><td>N/A</td></tr> <tr> <td>1.7 (7.13.4)</td><td>Tumbling barrel</td><td>P</td></tr> <tr> <td>1.7 (7.14)</td><td>Suspensions, fixings and means of adjusting</td><td>P</td></tr> <tr> <td>1.7 (7.14.1)</td><td>Mechanical load:</td><td>N/A</td></tr> <tr> <td></td><td>A) four times the weight</td><td>N/A</td></tr> </table>	1.7 (7.13.2)	Metal parts have adequate mechanical strength	N/A	1.7 (7.13.3)	Test with straight unjointed test finger	N/A	1.7 (7.13.4)	Tumbling barrel	P	1.7 (7.14)	Suspensions, fixings and means of adjusting	P	1.7 (7.14.1)	Mechanical load:	N/A		A) four times the weight	N/A	Information
1.7 (7.13.2)	Metal parts have adequate mechanical strength	N/A																		
1.7 (7.13.3)	Test with straight unjointed test finger	N/A																		
1.7 (7.13.4)	Tumbling barrel	P																		
1.7 (7.14)	Suspensions, fixings and means of adjusting	P																		
1.7 (7.14.1)	Mechanical load:	N/A																		
	A) four times the weight	N/A																		
3	No approval / golden sample was provided for checking during this inspection.	Information																		
4	For item: 6.736.026, 6.736.027, the plug report and adapter report was provided by factory during inspection.	Information																		
5	One piece per item were sealed and kept in the factory.	Information																		
	 																			

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX

A. AQL and Defects Finding

Inspection Sampling Standard Adopted: ☒ ISO 2859-1			Nonconformity (defective)		
Inspection Plan:	Single sampling plans for normal Inspection		Critical	Major	Minor
Inspection Level:	Level II	AQL:	Not Allowed	1.5	4.0
Inspection with:	☐ approved sample	Sample Size:	200	200	200
☐ specific check list	☒ general check list				
Defect Description					
For item: 6.736.026					
Painting peel off			-	-	1
For item: 6.736.027					
Painting peel off			-	-	1
For item: 6.968.249					
Untrimmed thread end			-	-	1
For item: 6.968.250					
Glue mark on unit			-	-	1
Untrimmed thread end			-	-	1
For item: 6.968.475					
Untrimmed thread end			-	-	2
For item: 6.968.476					
Impurity on unit			-	-	1
For item: 6.968.548					
Untrimmed thread end			-	-	2
For item: 6.976.357					
Untrimmed thread end			-	-	1
For item: 7.260.143					
Untrimmed thread end			-	-	1
Total Found:			0	0	12
Max. Allowed:			0	7	14

Photo with description for above defects.

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.

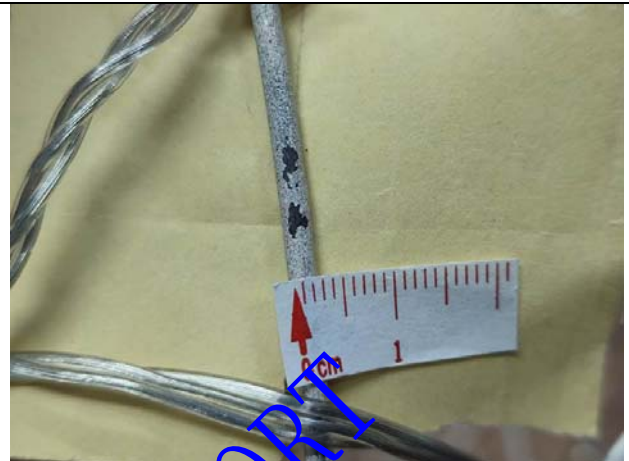


Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



1. Minor defect- Painting peel off of item: 6.736.026



2. Minor defect- Painting peel off of item: 6.736.027



3. Minor defect- Untrimmed thread end of item: 6.968.249



4. Minor defect- Glue mark on unit of item: 6.968.250



The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX

5. Minor defect- Untrimmed thread end of item: 6.968.250	6. Minor defect- Untrimmed thread end of item: 6.968.475
	
7. Minor defect- Untrimmed thread end of item: 6.968.475	8. Minor defect- Impurity on unit of item: 6.968.476
	
9. Minor defect- Untrimmed thread end of item: 6.968.548	10. Minor defect- Untrimmed thread end of item: 6.968.548

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



11. Minor defect- Untrimmed thread end of item:
6.976.357



12. Minor defect- Untrimmed thread end of item:
7.260.143

Inspected by	:	Haichu Lin	Signature	:	Haichu Lin
Reviewed by	:	Allen Chen	Signature	:	Allen CHEN

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX

B. Specification/Product requirement verification

B-1) Product requirement verification

For item: 6.736.027				
No.	Items verified	Client's requirement (input)	Actual finding (output)	Result
1.	Golden sample /Sampe test report	N/A (Golden sample view)	 (Actual product view)	☒ Pass ☐ Pending ☐ Fail refer to remark
		N/A (Golden sample view)	 (Actual product view)	
		N/A (Golden sample view)	 (Actual product view)	
		N/A (Golden sample view)	 (Actual product view)	
The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.				



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX

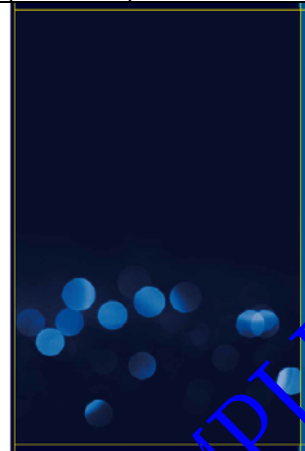
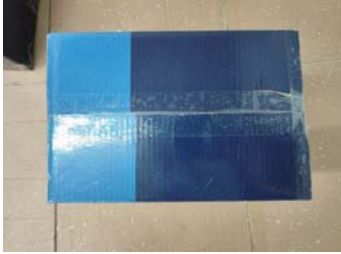
		N/A (Golden sample view)		
		N/A (Golden sample view)		
		N/A (Sampe test report view)	N/A	
2.	LVD report		Actual product was conformed to LVD report	☒ Pass ☐ Fail refer to remark
4.	Artwork/Gift box/ Hangtag			☒ Pass ☐ Pending ☐ Fail refer to remark

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX

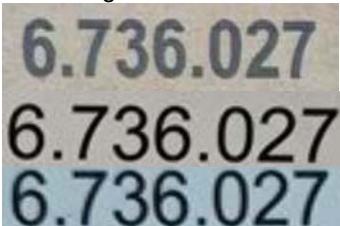
	 (Rear view)	 (Rear view)
	 (Side view-1)	 (Side view-1)
	 (Top view)	 (Top view)
	 (Bottom view)	 (Bottom view)

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX

5.	Barcode			☒ Pass ☐ Pending ☐ Fail refer to remark
6.	Silk-screen printing	 Show on gift box	 (Actual product)	☒ Pass ☐ Pending ☐ Fail refer to remark
8.	Importer information	www.coop.ch 0848 888 444 Postfach 2550 · CH-4002 Basel	www.coop.ch 0848 888 444 Postfach 2550 · CH-4002 Basel (Location: <u>Rating label</u>)	☒ Pass ☐ Pending ☐ Fail refer to remark
9	Production code on packaging	PO number + P + Production month + Production year 7079398532P1219 EG Production code format: Order number + letter "P" + production month and year (PO + "P" + MM+YY). If order number isn't available, at least keep the letter "P" + production month and year (EG production code can be printed on packaging or sealed by a sticker. If supplier has their own Lot number, the production code can be waived.	Lot: 7206256269P0726 Lot # 7206256269P0726 (Location: <u>On GB and rating label</u>)	☒ Pass ☐ Pending ☐ Fail refer to remark
10.	Swiss plug /adaptor verification Only for 230V AC product/ Adaptor	Swiss plug Type 11 (Class II,10 A, 250 V~)		☒ Pass ☐ Pending ☐ Fail refer to remark
14	Item no. consistency check (vendor item no. and client item no.)	On QA form: 213-386039-12 On booking form: Nil On PO/PI: 6.736.027	Actual item no. on carton/gift box/rating label/ IM: 	☒ Pass ☐ Pending ☐ Fail refer to remark

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX

			6.736.027	
15.	Seal sample check – Function and appearance check	Nil	Function and appearance check result was ok	☒ Pass ☐ Pending ☐ Fail refer to remark
16.	Seal sample packaging check – Protection on packaging is enough or not	Seal sample requirement: 1. One piece per item were sealed and kept in the factory. 2. One piece of item: 6.736.026 and 7.260.143 were sealed to C7	Protection on packaging was enough	☒ Pass ☐ Pending ☐ Fail refer to remark

For item: 6.968.250

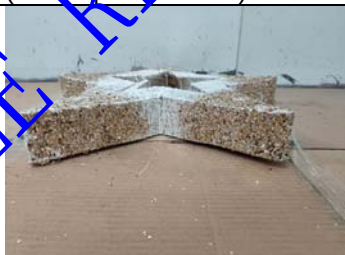
No.	Items verified	Client's requirement (input)	Actual finding (output)	Result
1.	Golden sample /Sampe test report	N/A (Golden sample view)	 (Actual product view)	☒ Pass ☐ Pending ☐ Fail refer to remark
		N/A (Golden sample view)	 (Actual product view)	
		N/A (Golden sample view)		

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX

		N/A (Golden sample view)	(Actual product view) 	
		N/A (Golden sample view)	(Actual product view) 	
		N/A (Golden sample view)	(Actual product view) 	
		N/A (Sampe test report view)	N/A	
2.	LVD report	 (LVD report view)		Actual product was conformed to LVD report ☒ Pass ☐ Fail refer to remark

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX

3. Artwork/Gift box/
Hangtag



(Front view)



(Front view)



(Side view-1)



(Side view-1)

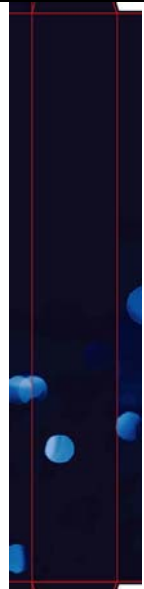

☒ Pass
☐ Pending
☐ Fail
refer to remark

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX

		 (Side view-2)	 (Side view-2)	
		 (Top view)	 (Top view)	
		 (Bottom view)	 (Bottom view)	
4.	Barcode	 7 627534 969370	 7 627534 969370	☒ Pass ☐ Pending ☐ Fail refer to remark

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX

6.	Silk-screen printing	 Show on gift box	 (Actual product)	☒ Pass ☐ Pending ☐ Fail refer to remark
10.	Swiss plug /adaptor verification Only for 230V AC product/ Adaptor	Swiss plug Type 11 (Class II,10 A, 250 V~)		☒ Pass ☐ Pending ☐ Fail refer to remark
13.	Item no. consistency check (vendor item no. and client item no.)	On QA form: 19-33324N On booking form: Nil On PO/PI: 6.968.250	Actual item no. on carton/gift box/rating label: 6.968.250 6.968.250 6.968.250	☒ Pass ☐ Pending ☐ Fail refer to remark
14.	Seal sample check – Function and appearance check	Nil	Function and appearance check result was ok	☒ Pass ☐ Pending ☐ Fail refer to remark
15.	Seal sample packaging check – Protection on packaging is enough or not	Seal sample requirement: 1. One piece per item were sealed and kept in the factory. 2. One piece of item: 6.736.026 and 7.260.143 were sealed to C7	Protection on packaging was enough	☒ Pass ☐ Pending ☐ Fail refer to remark

B-2) Packing material










Export carton	New export carton	☒
Fasting	Metal staples	☐
Sealing	Transparent gummed tape	☒
	Opaque gummed tape	☐
	Paper tape	☐

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX

Strapping	Nylon	☐									
Material	Ply of cardboard	Spec: <table border="1"> <thead> <tr> <th>Packing unit mass</th> <th>Cardboard type</th> </tr> </thead> <tbody> <tr> <td>< 10 kg</td> <td>1-wavy cardboard </td> </tr> <tr> <td>≥ 10 kg and < 30 kg</td> <td>2-wavy cardboard </td> </tr> <tr> <td>≥ 30 kg</td> <td>3-wavy cardboard </td> </tr> </tbody> </table> Actual: ☐ 3ply (single wall) ☒ 5ply (double wall) ☐ 7ply (triple wall)		Packing unit mass	Cardboard type	< 10 kg	1-wavy cardboard 	≥ 10 kg and < 30 kg	2-wavy cardboard 	≥ 30 kg	3-wavy cardboard 
Packing unit mass	Cardboard type										
< 10 kg	1-wavy cardboard 										
≥ 10 kg and < 30 kg	2-wavy cardboard 										
≥ 30 kg	3-wavy cardboard 										
Others	Poly foam inside packing	☐ Yes	☐ No								

B-3) Packaging information

	Qty per selling unit	Carton size (cm)			N.W. (kg)	G.W. (kg)
		L(cm)	W(cm)	H(cm)		
Item: 6.736.026						
Gift box	1	52	32	52.5	1.140	2.390
Outer carton	1	54	33	54.5	2.390	3.06
Item: 6.736.027						
Gift box	1	32.5	21	32.5	0.730	1.120
Outer carton	1	34	24	34.5	1.120	1.580
Item: 6.968.249						
Gift box	1	57	36.5	48	1.80	3.070
Outer carton	1	58.5	38	50.5	3.070	3.980
Item: 6.968.250						
Gift box	1	57	9	61.3	0.930	1.460
Outer carton	1	59	11	63	1.460	2.100
Item: 6.968.475						
Gift box	1	43	29	43	1.050	2.020
Outer carton	1	45	31	45.5	2.020	2.460
Item: 6.968.476						
Gift box	1	61.5	27.5	43.5	2.250	3.360
Outer carton	1	64	30	45.5	3.360	4.290
Item: 6.968.548						
Gift box	1	57	33	48.5	3.010	4.260
Outer carton	1	59	34.5	50.5	4.260	5.080

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX

Item: 6.976.357						
Gift box	1	25	25	100.5	2.790	3.970
Outer carton	1	102	27.5	27.5	3.970	4.660
Item: 7.260.143						
Gift box	1	98.5	33	63.5	4.7	7.040
Outer carton	1	99.5	34	65	7.040	8.530

B-4) Other information

	Please note							
1.	200 Cartons were randomly sampled from the batch of above item subjected for inspection.							
2.	☒ Selected carton number:							
	6.736.026	44	32	76	85	97	221	
	6.736.027	181	77	123	239	148	66	112
		151	53	191	71			14
	6.968.249	138	144	6	129	57	158	80
		86						176
	6.968.250	324	67	26	292	98	128	352
		326	90	211	421	171	105	301
		260	10	248	444	192	390	51
	6.968.475	236	94	127	592	102	479	915
		716	138	467	936	258	607	30
		765	129	528	8	386	735	158
		855	278	326	78	485	24	402
		347	783	525	64	907	446	837
		828	337	744	254	719		911
	6.968.476	513	626	650	479	242	678	367
		487	185	556	253	646	322	397
		87	480	178	548	246	638	19
		404	80	473	170	541	238	412
		678	375					314
	6.968.548	142	348	720	639	444	249	12
		313	33	349	658	98	414	314
		421	141	765	485	205	829	314
		837	557	277	873	593	285	314
		377	239	863	555	275	842	311
		31	598	319	39			
	6.976.357	116	90	192	171	129	80	37
		82	18	177				210
	7.260.143	190	30	330	214	65	37	230
		221	40	298	150	12	216	86
		278						245

C. ON-SITE CHECKING

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX

Test performed	Sample size	Result	Comments	Photo #
Appearance check	200pcs	Pass	-	-
Hi-pot check	200pcs	Pass	3300V/5mA 2s, no breakdown	401
Basic function check	200pcs	Pass	Power on at 230Vac 50Hz	402-410
Smell check	200pcs	Pass	Picks and opens a carton of goods and then immediately smells the packaging materials (the gift box, plastic tray and polybag, etc.) and also the product as well for any strong smell existing	411-414
Input power consumption check	200pcs	Pass	At 230V/50Hz Actual finding: 3.5~4.1W	402-410
Color deviation check for GB/units	200pcs	Pass	No color deviation among gift boxes/units	433
Full function check	13pcs	Pass	Check according to instruction manual and package artwork	402-410
Internal check	13pcs	Pass	Check internal workmanship	301-307
Critical component check (CDF check)	13pcs	Pass	See section D	
Barcode scan check	2pcs	Pass	Readable and correct against printed number	415-432
Endurance check (Max. setting)	2pcs	Pass	230V/50Hz 4hrs. No deformation on plug before and after the test	434-435
Power cord length check	2pcs	Pass	Actual finding: 498~504cm	436
Strain relief check	2pcs	Pass	100N 25 times displacement less than 2mm	437
Application check	2pcs	Pass	Actual use	402-410
Rubbing check	2pcs	Pass	15s with a piece of cloth soaked with water/alcohol for printing/markings	438-439
Swiss plug valid check	2pcs	Pass	Check with certification and actual marking: JT-DC31V3.6W-E4-IP55 and JT-DC31V3.6W-E4-IP55 Available on website dated: (15/06/2026)	440-443
Swiss Plug size check Diameter of plug pin: 4+/-0.06mm Distance between L and N plug pin: 19+/-0.15mm Distance between earthing plug pin and L/N plug pin (for Class I): 5+/-0.1mm	5 pcs	Pass	Actual finding: Diameter of plug pin(mm): 3.98~4.02 Distance between L and N plug pin(mm): 18.95~19.02 Distance between earthing plug pin and L/N plug pin(mm): N/A	444-445

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX

Master carton drop test conduct drop test according to ISTA 1A procedure	1carton	Pass	76.2cm height 1coner/3edges/6sides	446
The reason if not conduct the carton drop check: ☐ -Fragile goods with fragile goods warning on the outer carton. ☐ -Carton gross weight > 35Kg. ☐ -Refused by factory/Supplier with guarantee letter or their internal drop check pass result record, pending the result if could not provide related support documents. ☐ -Waived by client.				
Importer information check	2pcs	Pass	Found on rating label	--
Unit drop check for adaptor	5 pcs	Pass	1in, 6 sides Verify the stability & safety (hi-pot check) of the adaptor housing	447
Pull check (before & after unit drop check) for adaptor housing	20 pcs	Pass	No damage, no detached No factory spec available, please refer to remark 1	448
Tumbling test for adaptor	2pcs	Pass	refer to remark 2	--
Water proof check (for Christmas Lighting)	2pcs	Pass	No any water insider adaptor and lamp holder	449
Internal Check (for Christmas Lighting)	13pcs	Pass	Check any rusty in the lamp holder Check the Adaptor PCB against LVD report	--

D. Critical component data

For item: 6.736.026, 6.736.027

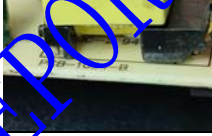
Critical components of appliance were checked with test report no. SHES251202171902 released by SGS.

No.	Component	Required on CDF / safety test report	Actual finding (Photo)	Result
1.	Plug	JT-DCxVvW-HS-IP55 Input: 220-240 VAC, 50-60Hz Output: 230-240 VAC, 50 Hz 100-240 VAC, 50-60 Hz 2-40 VDC, max 7.2 W, IP55 ta: 40 °C, tc: 75 °C CH Typ 11, Standard Sheet 5511-2		☒ Pass ☐ Fail, refer to remark

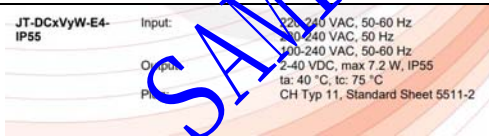
The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.

Report No.: GIS-2606036901

Report Date: 20XX-XX-XX

2.	Y1	Y 1 capacitor (alternative)	D	Hawtry Electronics(Dongguan) Co.,Ltd	CD Series	470pF 1000 pF; 1500 pF; 2200 pF; 400 VAC; 40/125/21C		☒ Pass ☐ Fail, refer to remark
3.	Transformer	Transformer	C	Changzhou Jutai Electronic Co., Ltd.	TRN-x (x stand for running number)	Class B acc. IEC/EN 61347-1 IEC/EN 61347-2-13		☒ Pass ☐ Fail, refer to remark
4.	Fuse resistor	Fuse resistor (alternative)	D	Shenzhen Great Electronics Co., Ltd.	RXF	4.7Ω - 250 Ω; 1W / 2W		☒ Pass ☐ Fail, refer to remark
5.	PCB	PCB (alternative)	D	Changzhou Kelong Electronics Co., Ltd.	JC-1; JC-2; JC-3	V-0; 130°C		☒ Pass ☐ Fail, refer to remark

For item: 6.968.249, 6.968.250, 6.968.475, 6.968.476, 6.968.548, 6.976.357, 7.260.143
Critical components of appliance were checked with test report no. SHES251102134701 released by SGS.

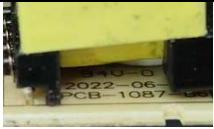
No.	Component	Required on CDF / safety test report				Actual finding (Photo)	Result	
1.	Plug						☒ Pass ☐ Fail, refer to remark	
2.	Y1	Y1 capacitor (alternative)	D	Shantou High-new Technology Dev. Zone Songtian Enterprise Co., Ltd.	CD-Series	470pF 1000 pF; 1500 pF; 2200 pF; 250/400V AC; 25/125/21/C		☒ Pass ☐ Fail, refer to remark
3.	Transformer	Transformer	C	Changzhou Jutai Electronic Co., Ltd.	TRN-x (x stand for running number)	Class B acc. IEC/EN 61347-1 IEC/EN 61347-2-13		☒ Pass ☐ Fail, refer to remark
4.	Fuse resistor	Fuse resistor	C	Changzhou southern Electronic element factory Co., Ltd.	RXF	4.7Ω - 250 Ω; 1W / 2W		☒ Pass ☐ Fail, refer to remark

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX

5.	PCB	<table><tr><td>PCB (alternative)</td><td>D</td><td>Changzhou WujinKechuang Electronics Co., Ltd.</td><td>KC-1; KC-2; KC-3</td><td>V-0; 130°C</td></tr></table>	PCB (alternative)	D	Changzhou WujinKechuang Electronics Co., Ltd.	KC-1; KC-2; KC-3	V-0; 130°C		☒ Pass ☐ Fail, refer to remark
PCB (alternative)	D	Changzhou WujinKechuang Electronics Co., Ltd.	KC-1; KC-2; KC-3	V-0; 130°C					

GIS SAMPLE REPORT

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX

E. Inspection Photos

E.1 Package Photos



102 Warehouse



103 Warehouse



105 Warehouse



106 Warehouse

Item: 6.736.026

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



111 Export carton



114 Side mark



116 Open carton



117 Gift box



119 Gift box



120 Gift box

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



127 Gift box packing



128 Gift box packing



129 Product packing



130 Marking on polybag

Item: 6.736.027



131 Export carton



134 Side mark

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



136 Open carton



137 Gift box



145 Gift box detail



146 Gift box detail



147 Gift box packing



148 Gift box packing

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



149 Product packing



150 Marking on polybag

Item: 6.968.249



151 Export carton



154 Side mark



155 Label on carton



156 Open carton

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



157 Gift box



158 Gift box



159 Gift box



160 Gift box



167 Gift box detail



168 Gift box detail

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



169 Gift box packing



170 Gift box packing



171 Product packing



172 Marking on polybag

Item: 6.968.250



173 Export carton



178 Open carton

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



179 Gift box



180 Gift box



181 Gift box



182 Gift box



187 Gift box detail



188 Gift box detail

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



189 Gift box packing



190 Gift box packing



191 Product packing



192 Marking on polybag

Item: 6.968.475



193 Export carton



196 Side mark

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



198 Open carton



199 Gift box



1005 Gift box detail



1006 Gift box detail



1007 Gift box detail



1008 Gift box packing

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



1009 Product packing



1010 Marking on polybag

Item: 6.968.476



1011 Export carton



1014 Side mark



1016 Open carton



1017 Gift box

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



1025 Gift box packing



1026 Gift box packing



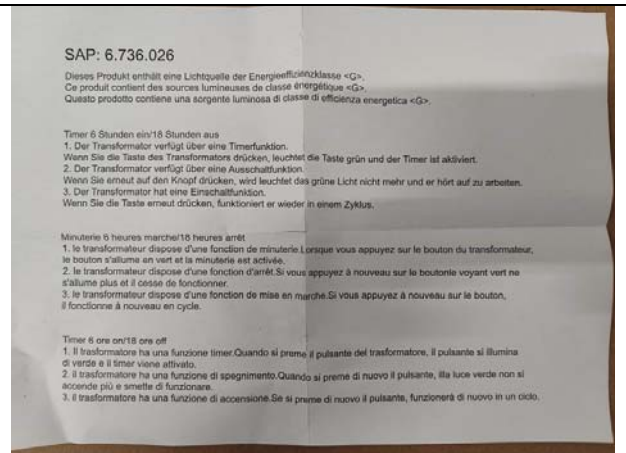
1027 Product packing



1028 Marking on polybag

E.2 Product Photos

Item: 6.736.026



The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX

201 All parts



202 IM



203 Product packing



204 Product packing




205 cable tie




206 Adapter



207 Adapter



208 Adapter



The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



209 Adapter



210 Plug



211 Adapter



214 Product view



215 Product view



216 Product view

Item: 6.736.027

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.

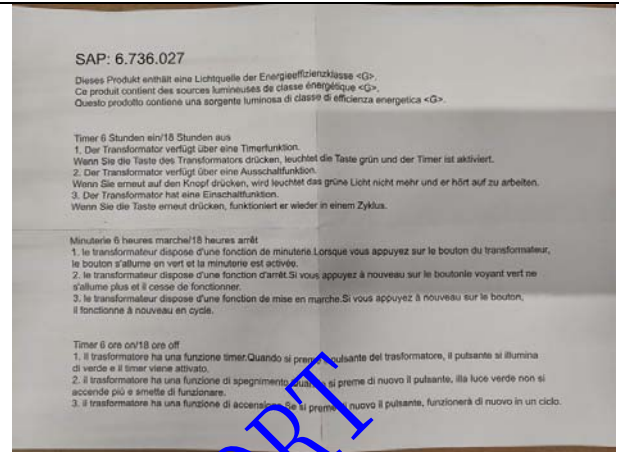


Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



217 All parts



218 IM



219 Product packing



220 Product packing



221 cable tie



222 Adapter

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



223 Adapter



224 Adapter



225 Adapter



226 Plug



227 Adapter



230 Product view

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



231 Product view



232 Product view

Item: 6.968.249



233 All parts



234 Product packing



235 Product packing



236 Product packing

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



237 Accessory



238 Adapter



239 Adapter



240 Adapter



241 Adapter



244 Product view

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



245 Product view



246 Product view



247 Product view



248 Product view



249 Product view



250 Product view

Item: 6.968.250

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



251 All parts



252 Product packing



253 Product packing



254 Product packing



255 Accessory



256 Adapter

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



257 Adapter



258 Adapter



259 Adapter



262 Product view



263 Product view



264 Product view

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



265 Product view



266 Product view



267 Product view



268 Product view

Item: 6.968.475



269 All parts



270 Product packing

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



271 Product packing



272 Product packing



273 Accessory



274 Adapter



275 Adapter



276 Adapter

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



277 Adapter



280 Product view



281 Product view



282 Product view



283 Product view



284 Product view

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



285 Product view



286 Product view

Item: 6.968.476



287 All parts



288 Product packing



289 Product packing



290 Product packing

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



291 Accessory



292 Adapter



293 Adapter



294 Adapter



295 Adapter



298 Product view

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



299 Product view



2000 Product view



2001 Product view



2002 Product view



2003 Product view



2004 Product view

Item: 6.968.548

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



2005 All parts



2006 Product packing



2007 Product packing



2008 Accessory



2009 Adapter



2010 Adapter

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



2011 Adapter



2012 Adapter



2013 Adapter



2016 Product view



2017 Product view



2018 Product view

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



2019 Product view



2020 Product view



2021 Product view



2022 Product view

Item: 6.976.357



2023 All parts



2024 Product packing

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



2025 Product packing



2026 Product packing



2027 Product packing



2028 Accessory



2029 Adapter



2030 Adapter

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



2031 Adapter



2032 Adapter



2035 Product view



2036 Product view



2037 Product view



2038 Product view

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



2039 Product view



2040 Product view

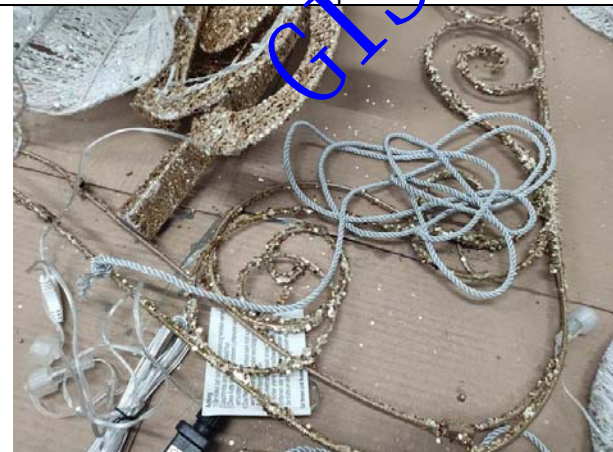
Item: 7.260.143



2041 All parts



2042 Product packing



2043 Product packing



2044 Product packing

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



2045 Product packing



2046 Accessory



2047 Accessory



2048 Adapter



2049 Adapter



2050 Adapter

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



2051 Adapter



2054 Product view



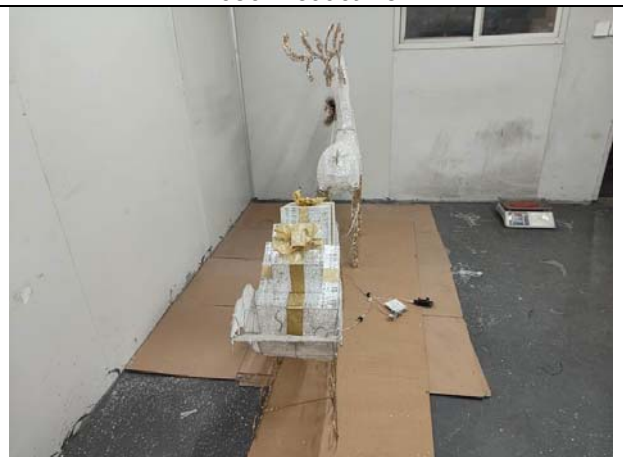
2055 Product view



2056 Product view



2057 Product view



2058 Product view

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



2059 Product view



2060 Product view

E.3 Internal Photos

Adapter of item: 6.968.249, 6.968.250, 6.968.475, 6.968.476, 6.968.548, 6.976.357, 7.260.143



301 Internal check



302 Internal check

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



303 Internal check



304 Internal check

Adapter of item: 6.736.026, 6.736.027



305 Internal check



306 Internal check

N/A



307 Internal check

N/A

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX

E.4 On-site Photos



401 Hi-pot check



402 Function check



403 Function check



404 Function check



The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX

405 Function check



406 Function check



407 Function check



408 Function check



409 Function check



410 Function check



411 Smell check

412 Smell check

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



413 Smell check



414 Smell check



415 Barcode scan check



416 Barcode scan check



433 Color deviation check for GB/units



434 Endurance check (Max. setting)

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.

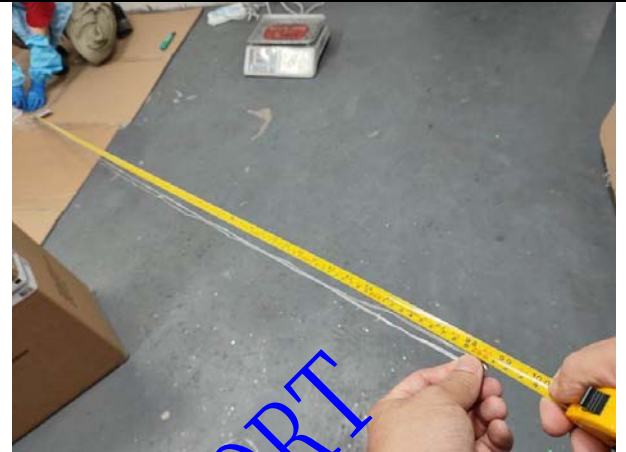


Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



435 Endurance check (Max. setting)



436 Power cord length check



437 Strain relief check



438 Rubbing check



439 Rubbing check

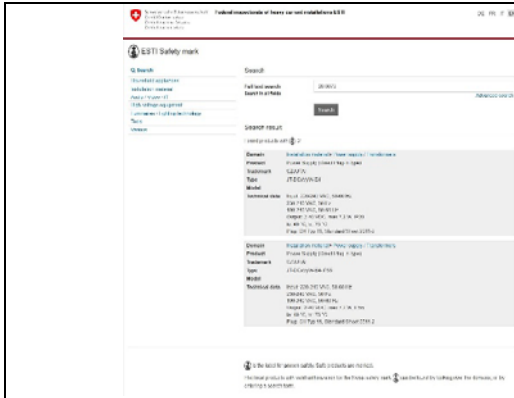


440 JT-DC31V3.6W-E4-IP55

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.

Report No.: GIS-2606036901

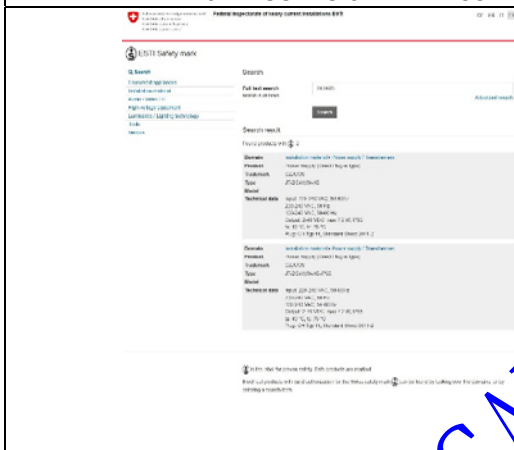
Report Date: 20XX-XX-XX



441 JT-DC31V3.6W-E4-IP55



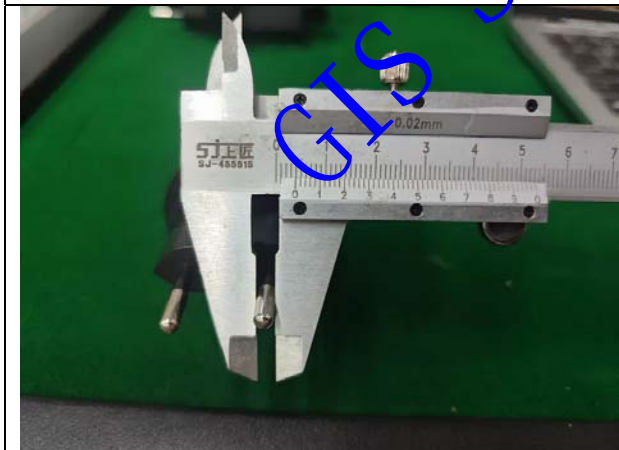
442 JT-DC31V3.6W-E4-IP55



443 JT-DC31V3.6W-E4-IP55



444 Swiss Plug size check



445 Swiss Plug size check



446 Carton drop test

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.



Report No.: GIS-2606036901

Report Date: 20XX-XX-XX



447 Unit drop check for adaptor



448 Pull check



449 Water proof check



Weight check

N/A



Size check

N/A

-END OF REPORT-

The report reflects the findings at the time and place of inspection. This report does not relieve the sellers/manufacturers from their contractual liabilities or prejudice the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter. This report does not evidence shipment.