



Report No : GIS-14090329

Report date : 20XX-XX-XX

INSPECTION REPORT

I.GENERAL INFORMATION

Applicant	:	-	
Attn	:	-	
Supplier	:	-	
Factory	:	-	
Factory Address	:	Yiwu, China	
P/O No.	:	-	
P/O Quantity	:	12000PCS	
Model/Art/Style	:	mascara	
Product Description	:	MASCARA CON COLAGENO water proof MASC WATERP.MAS VOLUMEN	
Inspection type	:	Pre-shipment Inspection	
Inspection method	:	☒ GWI-IC	
Inspection date	:	20XX-XX-XX	

II.INSPECTION RESULT (Details can be referred to corresponding sections in this report)

	INSPECTION ITEMS	Conformed	Not conformed	
1	Quantity	☒	☐	Refer to part 1-Quantity breakdown
2	Workmanship	☐	☒	Refer to remark 1,3 and workmanship table
3	Product Description	☒	☐	
4	On site check	☐	☒	Refer to remark 2
5	Form of Packaging	☒	☐	
6	Shipping Mark	☒	☐	
OVERALL CONCLUSION		Not conformed, refer to remark 1-3 and workmanship table		
FINAL DECISION		Client will make the final decision to reject or approve the conclusion		
Inspector	:	CXJ	Supervisor's signature	

Important:

The above reflects our findings at the time and place of inspection based on random- selected samples in accordance with the previously agreed random statistical sampling standards. Any "test" or "check" listed in our reporting should not be regarded as the laboratory testing since they are conducted in different way. The report/certificate does not mean releasing for shipment. This report/certificate does not exempt sellers/suppliers from their commercial, legal or contractual obligations with regard to quality/quantity of delivery nor does it prejudice the buyer's right of claim toward sellers/suppliers for compensation for any found and/or hidden defects not detected during our random inspection or occurring thereafter.




Report No : GIS-14090329

Report date : 20XX-XX-XX

INSPECTION REPORT

REMARKS:

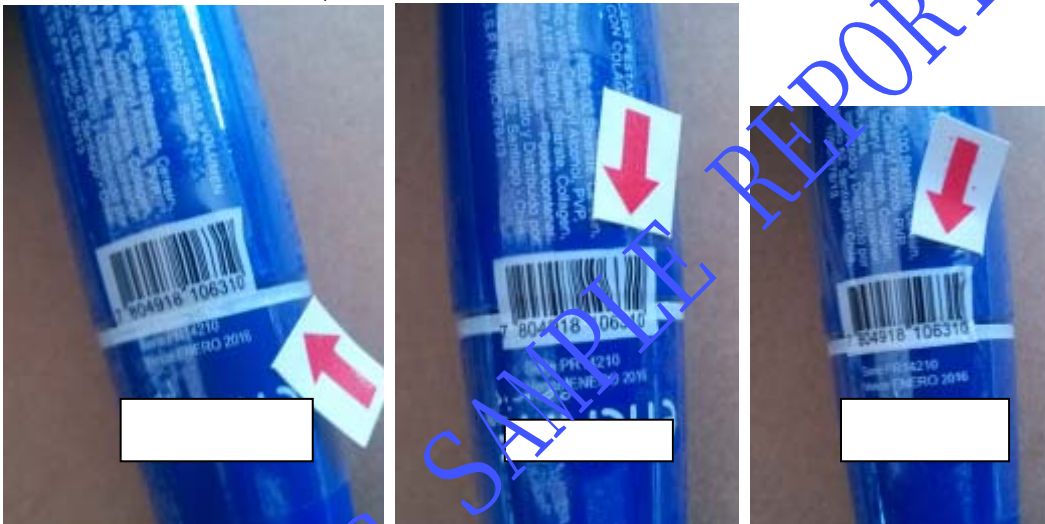1	For all the inner box, dirty mark on the surface. 
2	For all the barcode on the unit, the barcode can't be read. 
3	For 20% (63pcs) out of inspected products, the letters on the blister were found curved. 

NOTE:

1	Carton no. was not assigned yet Inspected sample Identification No.: GIS-14090329, 1~315
2	Manufacturer did not agree with us to draw one production sample to GIS office for reference.
3	Manufacturer did not agree with us to draw defective sample to GIS office for reference.



Report No : GIS-14090329

Report date : 20XX-XX-XX

INSPECTION REPORT

III.INSPECTION ITEM DETAILS (SECTION 1-6)

1. QUANTITY

PO No.	Item No.	PO Qty		shipment Qty		packed Qty		Unpacked Qty	Unfinished Qty	Sampling Size		
										Packed		Not packed
		pcs	ctns	pcs	ctns	pcs	ctns	pcs	pcs	pcs	ctns	pcs
-	Mascara	12000	29	12000	29	12000	29	0	0	315	6	0
Total		12000	29	12000	29	12000	29	0	0	315	6	0

2. WORKMANSHIP

Inspection Standard: ANSI/ASQC Z1.4		Defect classification	Cr	Ma	Mi
Sampling Plan:	Single, Normal	AQL	0	2.5	4.0
Inspection Level:	☒ G-II	Sample size	315	315	315
The defects which were found during inspection were listed as below:					
Item: Mascara					
1	Missing printing on the product		-	25	-
2	Broken at the blister		-	7	-
3	Extra printing at the head		-	3	-
4	Ingredient substance inside the tube		-	1	-
5	The logo on head not same level from tube		-	1	-
Total Found:			0	37	0
Allowed:			0	14	21
Result			FAIL		



Report No : GIS-14090329

Report date : 20XX-XX-XX

INSPECTION REPORT

3. PRODUCT DESCRIPTION, STYLE AND COLOUR

3.1 Check against PO/photos/client's other's specification

The inspected samples were found similar to the description of PO/photos/other's specification.

3.2 Check against sample.

No submitted sample was provided by applicant or Vendor for style & color comparison

3.3 Check against Instruction Manual

No instruction manual is included.

4. ON SITE CHECK

-	Check points	Criteria	Sample size	Comment	
1	Product Appearance	Open packing to check the product content cleanliness	(315Samples):	Conformed.	
2	Smell check	Without abnormal smell	(315Samples):	Conformed.	
3	Date of validity check	-	(315Samples):	Conformed.	
4	Drop test	61cm,10times	(1Carton):	Conformed.	
5	Size check	-	(5Samples):	Actual found: 12cmL	
6	Weight check	-	(5Samples):	Actual found: 32.7g, 31.8g, 31.3g, 32.1g, 30.9g	
7	Tape test (silk-screen printing)	3M 810	(5Samples):	Conformed.	
8	Rub check (silk-screen printing)	With water	(5Samples):	Conformed.	
9	Barcode readability check	Readable	(5Samples):	Not Conformed, refer to remark 2	
	Item No.	Barcode No.	Location	Barcode No.	Location
	-	27804918106314	A	17804918106317	F
		780491810630	D		
	*Location code: A-Export Carton; B-Gift Box; C-Blister Card; D-Unit; E-Hangtag; F-Inner White Box; G-Other				



Report No : GIS-14090329

Report date : 20XX-XX-XX

INSPECTION REPORT

5. PACKAGING:

-Packing method

Outer Pack	Corrugated Paper Plies:	☐ Single Wall(3ply) ☒ Double Wall(5ply) ☐ Triple Wall(7ply)
	Fastening:	☒ Metal Staples ☐ Glue
	Sealed by:	☐ Kraft Tape ☐ Opaque Gummed Tape ☒ Transparent Gummed Tape
	Strapping:	☒ Nylon Band,4 pcs ☐ No
Inner packing	70 inner boxes (total 420pieces) per export carton.	
	6 pieces solid color and solid size per inner packed.	
Unit pack	-	

- Packaging information

Item No.	Carton size (spec from client)	Carton size marked on carton	Carton size (actual)	Carton Weight (Spec from client)(kg)	Carton Weight marked on carton(kg)	Carton (actual)(kg)
	LxWxH (cm)	LxWxH(cm)	LxWxH(cm)	N.W/G.W	N.W/G.W	N.W/G.W
Mascara	-	-	38L x 36W x 26H	-	-	-/ 14.96kgs

6. SHIPPING MARK:

Please refer to photos.



Report No : GIS-14090329

Report date : 20XX-XX-XX

INSPECTION REPORT

PHOTO ATTACHMENT



1_cargo storage



2_export carton



5_opened export carton



7_inner box



8_marking on box



9_marking on box



Report No : GIS-14090329

Report date : 20XX-XX-XX

INSPECTION REPORT



13_opened inner box



14_inner product view



15_inner product view



16_printing on tube



17_printing on tube



18_marks on blister



Report No : GIS-14090329

Report date : 20XX-XX-XX

INSPECTION REPORT



19_marks on blister



20_marks on blister



21_printing on tube



22_clear blister



23_product details



24_product details



Report No : GIS-14090329

Report date : 20XX-XX-XX

INSPECTION REPORT



25_product details



26_product details



27_product details



28_drop test



29_drop test



30_drop test



Report No : GIS-14090329

Report date : 20XX-XX-XX

INSPECTION REPORT



31_size of export carton



32_weight of export carton



33_size of inner box



34_weight of inner box



35_barcode scan on export carton




36_barcode scan on inner box




Report No : GIS-14090329

Report date : 20XX-XX-XX

INSPECTION REPORT

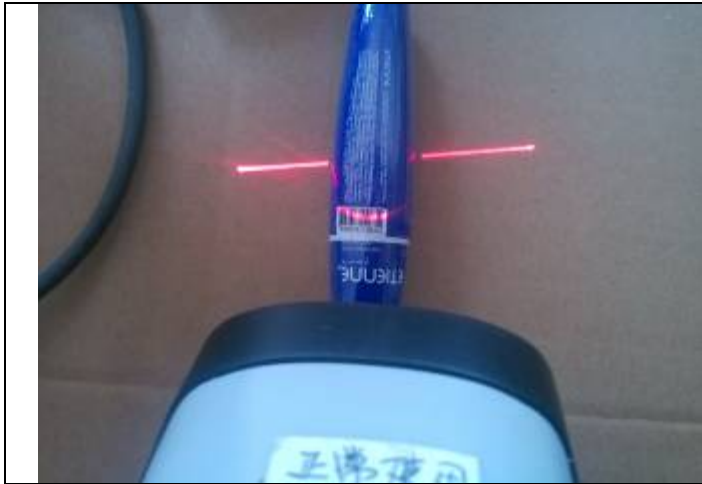

37_barcode scan on product

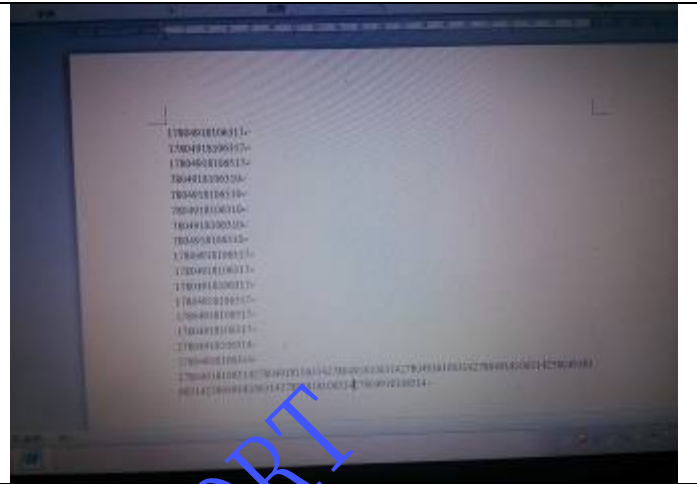

38_barcode scan



39_3M tape test



39_4M tape test



41_rub check



42_weight of unit product



Report No : GIS-14090329

Report date : 20XX-XX-XX

INSPECTION REPORT



43_size of product



44_remark-1



45_remark-1



46_remark-1



47_remark-1



48_remark-2



Report No : GIS-14090329

Report date : 20XX-XX-XX

INSPECTION REPORT



49_remark-2



50_remark-2



51_remark-2



52_remark-2



53_remark-2



54_remark-3



Report No : GIS-14090329

Report date : 20XX-XX-XX

INSPECTION REPORT



55_remark-3



56_remark-3



57_remark-3



58_remark-3



59_remark-3



60_defect-missing printing on the product-ma



Report No : GIS-14090329

Report date : 20XX-XX-XX

INSPECTION REPORT



61_defect-missing printing on the product-ma



62_defect-missing printing on the product-ma



63_defect-missing printing on the product-ma



64_defect-missing printing on the product-ma



65_defect-missing printing on the product-ma



66_defect-missing printing on the product-ma



Report No : GIS-14090329

Report date : 20XX-XX-XX

INSPECTION REPORT



67_defect-missing printing on the product-ma



68_defect-missing printing on the product-ma



69_defect-missing printing on the product-ma



70_defect-missing printing on the product-ma



71_defect-missing printing on the product-ma



72_defect-missing printing on the product-ma



Report No : GIS-14090329

Report date : 20XX-XX-XX

INSPECTION REPORT



73_defect-missing printing on the product-ma



74_defect-missing printing on the product-ma



75_defect-missing printing on the product-ma



76_defect-missing printing on the product-ma



77_defect-broken at the blister-ma



78_defect-broken at the blister-ma



Report No : GIS-14090329

Report date : 20XX-XX-XX

INSPECTION REPORT



79_defect-broken at the blister-ma



80_defect-broken at the blister-ma



81_defect-broken at the blister-ma



82_defect-broken at the blister-ma



83_defect-broken at the blister-ma



84_defect-extra printing at the head-ma



Report No : GIS-14090329

Report date : 20XX-XX-XX

INSPECTION REPORT



85_defect-extra printing at the head-ma



86_defect-extra printing at the head-ma



87_defect-ingredient substance inside the tube-ma



88_defect-the logo on head not same level from tube-ma

End